


Guide Bush C Model

بوش راهنمای مدل C

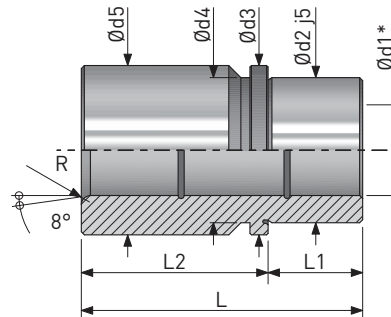


Ordering Code: GB/C/31/Ød1*L

Ordering Code Example: GB/C/31/20*59

Material: 1.2067, 1.2007

Deep Hardness: 60 ± 2 HRC

Model	Ød1	Ød2	Ød3	Ød4	Ød5	L	L1	L2	R
GB/C/31/20*59	20	32	40	32	39	59	23	36	3
GB/C/31/25*79	25	40	48	40	46	79		56	
GB/C/31/30*93	30	48	56	48	53	93	30	63	
GB/C/31/40*108	40	58	66	58	63	108	37	71	
GB/C/31/50*127	50	70	80	70	77	127	47	80	
GB/C/31/60*150	60	85	95	85	92	150	60	90	3.5

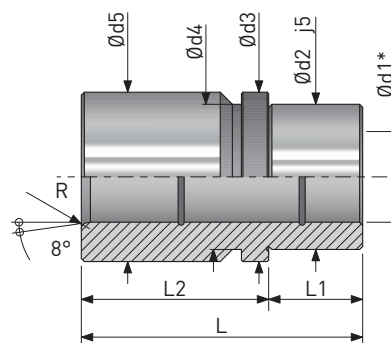

Ordering Code: GB/C/32/Ød1*L

Ordering Code Example: GB/C/32/20*72

Material: 1.2067, 1.2007

Deep Hardness: 60 ± 2 HRC

Model	Ød1	Ød2	Ød3	Ød4	Ød5	L	L1	L2	R
GB/C/32/20*72	20	32	40	32	39	72	30	42	3
GB/C/32/25*80	25	40	48	40	46	80		50	
GB/C/32/30*93	30	48	56	48	53	93	37	56	
GB/C/32/40*110	40	58	66	58	63	110	47	63	3.5
GB/C/32/50*131	50	70	80	70	77	131	60	71	